



**QUICK CAMS
CASTER/CAMBER
ADJUSTMENT**

CHEVROLET AND
GENERAL MOTORS TRUCKS


THE PROBLEM SOLVER®

PROBLEM:

Difficulty adjusting caster/camber

- Space constraints on Chevy/GMC trucks limit access to the inboard OEM caster/camber adjustment cam, making adjustments difficult to perform.

INBOARD LOCATION MAKES
ADJUSTMENT DIFFICULT

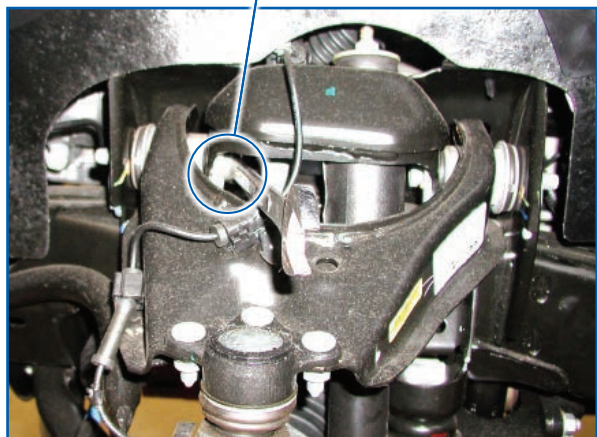

Description	Year	Make/Model	P/N
Quick Cam	2004-2012 2004-2012 2006-2010 2009 2006 2007-2008	Chevrolet Colorado 4WD GMC Canyon 4WD Hummer H3 Hummer H3T Isuzu i-280/i-350 Isuzu i-290/i-370	K6721
Quick Cam	2003-2014 2003-2014 2003-2009	Chevrolet Express Van GMC Savana 1500 Van GMC Savana 2500/3500 Van	K80277
Guide Pins	1999-2014	Chevrolet, GMC, Hummer	K6716

NOTE: The Quick Cams are problem solvers for the applications listed above. They fit many other Chevy/GMC vehicles as replacement parts.

SOLUTION:


MOOG® Quick Cam K6721 and K80277

- Replaces the non-adjustable outboard OEM cam.
- Easy-access Allen wrench slot enables fast and easy caster/camber adjustment.
- Allows for future adjustments.
- Works with the OEM bolt, cutting installation time greatly.



K6721

OUTBOARD LOCATION
AIDS IN ADJUSTMENTS

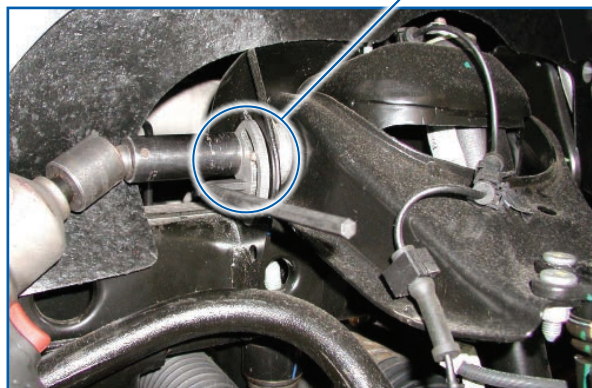

K6716

NOTE: MOOG also offers guide pins to replace those that break off.



For parts lookup, visit www.FMe-cat.com tech line: 1-800-325-8886

moogproblemsolver.com

